GRAHAM 🕇 SIBBALD

Delivering More. Caring More.


Home Report

30 Ceres Crescent Broughty Ferry Dundee DD5 3JN

Date of Valuation: 05/09/2024

UK Chartered Surveyors and Property Consultants

g-s.co.uk

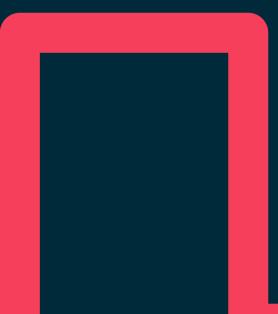

single survey

survey report on:

Property address	30 Ceres Crescent Dundee DD5 3JN

Customer	Kevin and Sheelagh Stokoe	

Prepared by Graham + Sibbald LLP

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a semi-detached single storey plus attic level
	dwelling erected by Messrs Bett Homes to their 'Almond` design.

Accommodation	Ground floor - Hallway, lounge, bathroom, kitchen, family room.
	First floor - Landing, two bedrooms, shower room.

Gross internal floor area (m ²)	97m ² approx.

Neighbourhood and location	The subjects form part of a long established private residential location
	within Broughty Ferry. Surrounding properties are of a similar nature
	and all amenities can be found within easy reach.

	Age (year built)	1960s
--	------------------	-------

Weather	Dry

30 Ceres Crescent Broughty Ferry Dundee DD5 3JN

Dundee DUN-2024\09\0029 Inspection Date:- 05/09/2024 First Inspection Date (if applicable):-

Chimney stacks	Not applicable.

	The most is of witched timber construction, outcomelly, bid in tiller and
Roofing including roof space	The roof is of pitched timber construction, externally laid in tiles and incorporates tiled ridging. The roof structure incorporates a timber framed dormer projection to the front pitch, appearing to have a flat lead covering (unseen). There is a timber framed double width dormer to the rear, appearing to have a flat felt covering (also unseen). There is a flat felt roof with asphalt covering over the rear extension.
	The upper level is incorporated within the roof structure and accordingly only very restricted access was gained to the roof timbers.
	Access to the roof space is via a hatch within the landing, giving a view of the apex. Insulation is present at joist level and only a restricted head and shoulders view was possible of this area. No access was gained to any roof timbers. There may be a hatch within the landing cupboard although due to contents, no access was gained.
	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

Rainwater fittings	The rainwater goods are of PVC design.
	Visually inspected with the aid of binoculars where appropriate.

Main walls	The main walls appear to be of cavity brick construction, externally roughcast, appearing to be both to the main building and extension.
	The walls incorporate timber weatherboarding and facing brick features to the front elevation.
	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected.

Windows, external doors and	Access to the property is via a timber entry door.
joinery	The windows are of timber casement double glazed design.
	There is a sliding metal casement double glazed door within the extension giving access to the garden.
	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.

External decorations	Elements of the external fabric have a painted/preservative finish.
	Visually inspected.

Conservatories / porches	Not applicable.

Communal areas	Not applicable.

Garages and permanent outbuildings	There is a single garage to the rear of the site. This is of sectional concrete panel construction, externally roughcast and has a corrugated cement board roof over.
	This has a manual up and over door. Visually inspected.

30 Ceres Crescent Broughty Ferry Dundee DD5 3JN Dundee DUN-2024\09\0029 Inspection Date:- 05/09/2024 First Inspection Date (if applicable):-

Outside areas and boundaries	There are areas of ground to the front, side and rear of the property and off-street parking is provided on a private drive, accessed at the rear.
	Site boundaries are defined by timber fencing and concrete block walls.
	Visually inspected.

Ceilings	The ceilings appear to be of plasterboard/lightweight boarding.
	Visually inspected from floor level.

Internal walls	The internal walls are of brick plastered on the hard and timber stud overlaid in plasterboard.
	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.

Floors including sub floors	The floors appear to be of suspended timber construction.
	Floors were fully covered and no access was gained to any sub-floor chambers.
	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so , and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch .

Internal joinery and kitchen	The internal doors, skirtings and architraves are of timber design.
fittings	The kitchen incorporates base and wall mounted units.
	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.

30 Ceres Crescent Broughty Ferry Dundee DD5 3JN Dundee DUN-2024\09\0029 Inspection Date:- 05/09/2024 First Inspection Date (if applicable):-

Chimney breasts and fireplaces	Not applicable.
Internal decorations	The internal surfaces have a papered/painted finish and there are
	areas clad in tiling/nanelling

	areas ciad in thing/panening.	
	Visually inspected.	

Cellars	Not applicable.
---------	-----------------

Electricity	Mains supply of electricity. The consumer unit is located within the understair cupboard.
	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.

Gas	Mains supply.
	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.

Water, plumbing, bathroom fittings	Mains supply. There is a sink unit in the kitchen and the plumbing, where viewed, is of PVC and copper design. There is a main bathroom at ground level and main shower at upper level.
	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	It should be appreciated that concealed areas beneath and around baths and shower trays could not be inspected. Water spillage in these areas can result in dampness/decay and no comment can be made on inaccessible areas. Waterproof seals in sanitary areas should be checked and maintained on a regular basis.

Heating and hot water	Space heating is by means of a gas fired system. There is an Ideal
heating and not water	
	condensing combination boiler located within the kitchen and this
	feeds wall-mounted radiators. The heating system appears to provide
	domestic hot water.
	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.

Drainage	Mains sewer connection assumed.
	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.

Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system
	or appliances. New smoke alarm standards were introduced in
	Scotland in February 2022 and it is likely that some properties may
	require additional works to meet these standards. In instances where
	alarms are in place, no tests whatsoever have been carried out and we
	cannot confirm if the system complies with the most recent
	regulations. Any potential purchaser should satisfy themselves as to
	whether the current system meets with regulations or otherwise.
	D5 3JN Page 7 of 26

Dundee DUN-2024\09\0029 Inspection Date:- 05/09/2024 First Inspection Date (if applicable):-

Additional limits to inspection	It should be appreciated that the Home Report inspection is a non-
	disruptive visual inspection of the property as at the date of inspection
	and that we are unable to inspect parts of the property which are
	concealed or covered by floor coverings or contents in place at that
	time. Once vacant, defects may be apparent that could not be detected
	during our survey. Changing weather conditions can also affect aspects
	of the property which would not be apparent at the time of inspection.
	No inspection for Japanese Knotweed was carried out and unless
	otherwise stated for the purpose of this report, it is assumed that
	there is no Japanese Knotweed within the boundaries of the property
	or in neighbouring properties.
	It is outwith the scope of this inspection to determine whether or not
	asbestos based products are present within the property. Asbestos
	was widely used in the building industry until around 1999, when it
	became a banned substance. If you have any concerns you should
	engage the services of a qualified asbestos surveyor.
	The property was fully furnished at the time of our inspection and the
	The property was fully furnished at the time of our inspection and the
	services were not tested.



Sectional Diagram showing elements of a typical house

1Chimney pots2Coping stone3Chimney head4Flashing5Ridge ventilation6Ridge board7Slates/tiles8Valley guttering9Dormer projection10Dormer flashing11Dormer cheeks12Sarking13Roof felt14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay window30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank40Hot water tank		_
3Chimney head4Flashing5Ridge ventilation6Ridge board7Slates/tiles8Valley guttering9Dormer projection10Dormer flashing11Dormer cheeks12Sarking13Roof felt14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window sills27Rendering28Brickwork / pointing29Bay window30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Floor joists38Floorboards39Water tank	1	Chimney pots
3Chimney head4Flashing5Ridge ventilation6Ridge board7Slates/tiles8Valley guttering9Dormer projection10Dormer flashing11Dormer cheeks12Sarking13Roof felt14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window sills27Rendering28Brickwork / pointing29Bay window30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Floor joists38Floorboards39Water tank	2	Coping stone
4Flashing5Ridge ventilation6Ridge board7Slates/tiles8Valley guttering9Dormer projection10Dormer flashing11Dormer cheeks12Sarking13Roof felt14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay window30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Floor joists38Floorboards39Water tank		Chimney head
7Slates/tiles8Valley guttering9Dormer projection10Dormer flashing11Dormer cheeks12Sarking13Roof felt14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window sills27Rendering28Brickwork / pointing29Bay window30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	4	Flashing
7Slates/tiles8Valley guttering9Dormer projection10Dormer flashing11Dormer cheeks12Sarking13Roof felt14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window sills27Rendering28Brickwork / pointing29Bay window30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	5	Ridge ventilation
8Valley guttering9Dormer projection10Dormer flashing11Dormer cheeks12Sarking13Roof felt14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window sills27Rendering28Brickwork / pointing29Bay window30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Floor joists38Floorboards39Water tank	6	Ridge board
9Dormer projection10Dormer flashing11Dormer cheeks12Sarking13Roof felt14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay windowprojectionSubfloor ventilator30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank		Slates/tiles
10Dormer flashing11Dormer cheeks12Sarking13Roof felt14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay window30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	8	Valley guttering
11Dormer cheeks12Sarking13Roof felt14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay windowprojectionSolum30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	9	Dormer projection
12Sarking13Roof felt14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window sills27Rendering28Brickwork / pointing29Bay window30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	10	Dormer flashing
13Roof felt14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	11	Dormer cheeks
14Trusses15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay windowprojectionSolum30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	12	Sarking
15Collar16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay windowprojectionSolum30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	13	Roof felt
16Insulation17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	14	Trusses
17Parapet gutter18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	15	Collar
18Eaves guttering19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	16	Insulation
19Rainwater downpipe20Verge boards / skews21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay windowprojection30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	17	Parapet gutter
 20 Verge boards / skews 21 Soffit boards 22 Partition wall 23 Lath / plaster 24 Chimney breast 25 Window pointing 26 Window sills 27 Rendering 28 Brickwork / pointing 29 Bay window projection 30 Lintels 31 Cavity walls / wall ties 32 Subfloor ventilator 33 Damp proof course 34 Base course 35 Foundations 36 Solum 37 Floor joists 38 Floorboards 39 Water tank 	18	Eaves guttering
21Soffit boards22Partition wall23Lath / plaster24Chimney breast25Window pointing26Window sills27Rendering28Brickwork / pointing29Bay windowprojection30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	19	Rainwater downpipe
 Partition wall Lath / plaster Chimney breast Chimney breast Window pointing Window sills Rendering Brickwork / pointing Bay window projection Lintels Cavity walls / wall ties Cavity walls / wall ties Subfloor ventilator Base course Base course Foundations Solum Floor joists Water tank 	20	Verge boards / skews
 23 Lath / plaster 24 Chimney breast 25 Window pointing 26 Window sills 27 Rendering 28 Brickwork / pointing 29 Bay window projection 30 Lintels 31 Cavity walls / wall ties 32 Subfloor ventilator 33 Damp proof course 34 Base course 35 Foundations 36 Solum 37 Floor joists 38 Floorboards 39 Water tank 	21	Soffit boards
 24 Chimney breast 25 Window pointing 26 Window sills 27 Rendering 28 Brickwork / pointing 29 Bay window projection 30 Lintels 31 Cavity walls / wall ties 32 Subfloor ventilator 33 Damp proof course 34 Base course 35 Foundations 36 Solum 37 Floor joists 38 Floorboards 39 Water tank 	22	Partition wall
 25 Window pointing 26 Window sills 27 Rendering 28 Brickwork / pointing 29 Bay window 29 Bay window 29 projection 30 Lintels 31 Cavity walls / wall ties 32 Subfloor ventilator 33 Damp proof course 34 Base course 35 Foundations 36 Solum 37 Floor joists 38 Floorboards 39 Water tank 	23	Lath / plaster
 26 Window sills 27 Rendering 28 Brickwork / pointing 29 Bay window 29 Bay window 29 projection 30 Lintels 31 Cavity walls / wall ties 32 Subfloor ventilator 33 Damp proof course 34 Base course 35 Foundations 36 Solum 37 Floor joists 38 Floorboards 39 Water tank 	24	Chimney breast
 27 Rendering 28 Brickwork / pointing 29 Bay window 29 projection 30 Lintels 31 Cavity walls / wall ties 32 Subfloor ventilator 33 Damp proof course 34 Base course 35 Foundations 36 Solum 37 Floor joists 38 Floorboards 39 Water tank 	25	Window pointing
 28 Brickwork / pointing 29 Bay window projection 30 Lintels 31 Cavity walls / wall ties 32 Subfloor ventilator 33 Damp proof course 34 Base course 35 Foundations 36 Solum 37 Floor joists 38 Floorboards 39 Water tank 	26	Window sills
29Baywindowprojection30Lintels31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank	27	Rendering
 projection projection Lintels Cavity walls / wall ties Subfloor ventilator Damp proof course Base course Foundations Solum Floor joists Floorboards Water tank 	28	Brickwork / pointing
 30 Lintels 31 Cavity walls / wall ties 32 Subfloor ventilator 33 Damp proof course 34 Base course 35 Foundations 36 Solum 37 Floor joists 38 Floorboards 39 Water tank 	29	Bay window
31Cavity walls / wall ties32Subfloor ventilator33Damp proof course34Base course35Foundations36Solum37Floor joists38Floorboards39Water tank		
 32 Subfloor ventilator 33 Damp proof course 34 Base course 35 Foundations 36 Solum 37 Floor joists 38 Floorboards 39 Water tank 		
 33 Damp proof course 34 Base course 35 Foundations 36 Solum 37 Floor joists 38 Floorboards 39 Water tank 		
 34 Base course 35 Foundations 36 Solum 37 Floor joists 38 Floorboards 39 Water tank 		
 35 Foundations 36 Solum 37 Floor joists 38 Floorboards 39 Water tank 		
36 Solum37 Floor joists38 Floorboards39 Water tank		
37 Floor joists38 Floorboards39 Water tank	35	
38 Floorboards39 Water tank	36	Solum
39 Water tank		-
40 Hot water tank	39	
	40	Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with	Repairs or replacement	No immediate action or repair
them may cause problems to other parts of the property or cause	requiring future attention,	is needed.
a safety hazard. Estimates for repairs or replacement are needed	but estimates are still	
now.	advised.	

(Structural movement	
Repair		1
Notes		At the time of our inspection there was no evidence of significant structural movement noted to affect the property within the limits of our inspection.
	Dampne	ess, rot and infestation
Repair category	у	1
Notes		There was no evidence found of significant dampness, rot or infestation within those areas of the property available for inspection.
Chimney stacks		y stacks
Repair category	у	N/A
Notes		Not applicable.



Roofing including roof space

Repair category 2 Notes The roof covering appears original and is weathered consistent with age. Flat roof coverings were only partially inspected although it should be appreciated that flat roofs by nature, particularly those of felt material, have a limited life only. Any information as to their last renewal date should be obtained. The roof covering is now of an age where ongoing and regular maintenance will be required and it would be prudent to seek the advice of a roofing contractor to comment on its current condition and expected lifespan. Repair category 1 Notes At the time of our inspection there was no evidence of damp staining/water staining on wall surfaces which would indicate leakage. It should be noted that it was not raining at the time of our inspection. Main walls There are areas of cracked, bare and bossed roughcast. A metal lintel bearer bar is exposed to the gable and is rusting. Repair category 2 Notes There are areas of cracked, bare and bossed roughcast. A metal lintel bearer bar is exposed to the gable and is rusting. Repair category 2 Notes There are areas of cracked, bare and bossed roughcast. A metal lintel bearer bar is exposed to the gable and is rusting. Repair category 2		
Flat roof coverings were only partially inspected although it should be appreciated that flat roofs by nature, particularly those of felt material, have a limited life only. Any information as to their last renewal date should be obtained. The roof covering is now of an age where ongoing and regular maintenance will be required and it would be prudent to seek the advice of a roofing contractor to comment on its current condition and expected lifespan. Repair category 1 Notes At the time of our inspection there was no evidence of damp staining/water staining on wall surfaces which would indicate leakage. It should be noted that it was not raining at the time of our inspection. Repair category 2 Notes There are areas of cracked, bare and bossed roughcast. A metal lintel bearer bar is exposed to the gable and is rusting. Windows, external doors and joinery Windows, external doors and joinery	Repair category	2
Repair category 1 Notes At the time of our inspection there was no evidence of damp staining/water staining on wall surfaces which would indicate leakage. It should be noted that it was not raining at the time of our inspection. Image: I	Notes	Flat roof coverings were only partially inspected although it should be appreciated that flat roofs by nature, particularly those of felt material, have a limited life only. Any information as to their last renewal date should be obtained. The roof covering is now of an age where ongoing and regular maintenance will be required and it would be prudent to seek the advice of a roofing contractor to comment on its current condition and expected
Notes At the time of our inspection there was no evidence of damp staining/water staining on wall surfaces which would indicate leakage. It should be noted that it was not raining at the time of our inspection. Image: Main walls Main walls Repair category 2 Notes There are areas of cracked, bare and bossed roughcast. A metal lintel bearer bar is exposed to the gable and is rusting. Image: Mindows, external doors and joinery	Rainwat	ter fittings
staining on wall surfaces which would indicate leakage. It should be noted that it was not raining at the time of our inspection. Main walls Repair category 2 Notes There are areas of cracked, bare and bossed roughcast. A metal lintel bearer bar is exposed to the gable and is rusting. Windows, external doors and joinery	Repair category	1
Repair category 2 Notes There are areas of cracked, bare and bossed roughcast. A metal lintel bearer bar is exposed to the gable and is rusting. Image: Construction of the text of the text of text of the text of text	Notes	staining on wall surfaces which would indicate leakage. It should be noted
Notes There are areas of cracked, bare and bossed roughcast. A metal lintel bearer bar is exposed to the gable and is rusting. Image: Windows, external doors and joinery	Main wa	alls
bar is exposed to the gable and is rusting. Windows, external doors and joinery	Repair category	2
	Notes	-
Repair category 2	Window	vs, external doors and joinery
	Repair category	2

30 Ceres Crescent Broughty Ferry Dundee DD5 3JN Dundee DUN-2024\09\0029 Inspection Date:- 05/09/2024 First Inspection Date (if applicable):-

Notes		These are older units and the timbers are worn. Decay has affected some external parts and a general overhaul should be expected. Double glazed windows may be prone to misting/interstitial condensation which can be more evident and can change in certain temperatures/weather conditions.
	External	decorations
Repair catego	bry	2
Notes		Weathering was noted to external finishes and some refurbishment should be expected.
	Conserv	atories / porches
Repair catego	pry	N/A
Notes		Not applicable.
	Commu	nal areas
Repair catego	bry	N/A
Notes		Not applicable.
	Garages	and permanent outbuildings
Repair catego	bry	2
Notes		A general overhaul should be expected of the garage. Decay has affected timber elements and the main door is deflected (although operational). The roof may contain asbestos based materials and the advice of a specialist contractor should be sought prior to removal/disturbance.

•

Outside areas and boundaries

Repair catego	pry	2
Notes		The outside areas were found to be adequately maintained. Some sections of boundary are of an older type, including fencing, and ongoing maintenance/future upgrading should be expected.
	Ceilings	
Repair catego	bry	1
Notes		Within the limits of our inspection these generally appeared in fair condition consistent with age. During redecoration some plaster filling/repair may be required.
	Internal	walls
Repair catego	pry	1
Notes		Within the limits of our inspection these generally appeared in fair condition consistent with age. During redecoration some plaster filling/repair may be required.
	Floors ir	ncluding sub-floors

Repair category	2
Notes	The flooring appears in fair condition, with general loose and uneven areas noted.
	High damp levels were detected to the flooring adjacent to the upper floor shower unit. This should be investigated further and repaired as necessary.



Internal joinery and kitchen fittings

Repair catego	ry	1
Notes		The internal joinery is generally in keeping with the age and type of property and appeared in fair condition consistent with age.
		The kitchen units are of relatively modern design and appear in serviceable condition.
F	Chimney	y breasts and fireplaces
Repair catego	ry	N/A
Notes		Not applicable.
AND A	Internal	decorations
Repair catego	ry	1
Notes		The property appears in fair decorative order although it is recognised that on taking occupancy home owners may consider redecoration.
	Cellars	
Repair catego	ry	N/A
Notes		Not applicable.
	Electrici	ty

30 Ceres Crescent Broughty Ferry Dundee DD5 3JN Dundee DUN-2024\09\0029 Inspection Date:- 05/09/2024 First Inspection Date (if applicable):-

Notes		The consumer unit has been upgraded in the past although some time ago, it is unclear the extent of upgrading works having been carried out to concealed wiring. Any information as to past re-wiring works should be obtained, if available. It should be appreciated that only the most recently installed or re-wired properties comply with current regulations and as in all cases, we recommend that the system be checked prior to purchase by an NICEIC/Select registered electrical contractor prior to purchase.
	Gas	
Repair catego	ry	1
Notes		In the interest of safety all gas appliances should be checked by a Gas Safe Registered Engineer.
F	Water, j	plumbing and bathroom fittings
Repair catego	iry	2
Notes		The plumbing and fittings appear of copper/PVC piping where seen and appeared in serviceable condition but was not tested.
		Fittings are on older lines and spillage/leakage has affected flooring adjacent to the shower unit. Further investigation and repairs should be expected.
	Heating	and hot water
Repair catego	ry	2
		The central heating system incorporates a condensing boiler which is

The flue opening in the wall is untidy and there is no plate. Repairs should be expected. 30 Ceres Crescent Broughty Ferry Dundee DD5 3JN Dundee DUN-2024\09\0029 Inspection Date:- 05/09/2024 First Inspection Date (if applicable):-

purchase. This is assumed to be in order.

Page 15 of 26

Drainag	e
Repair category	1
Notes	The property is thought to be connected to a main sewer. There was no surface evidence to suggest the system is choked or leaking.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1	
Dampness, rot and infestation	1	
Chimney stacks	N/A	
Roofing including roof space	2	
Rainwater fittings	1	
Main walls	2	
Windows, external doors and joinery	2	
External decorations	2	
Conservatories / porches	N/A	
Communal areas	N/A	
Garages and permanent outbuildings	2	
Outside areas and boundaries	2	
Ceilings	1	
Internal walls	1	
Floors including sub-floors	2	
Internal joinery and kitchen fittings	1	
Chimney breasts and fireplaces	N/A	
Internal decorations	1	ı
Cellars	N/A	
Electricity	2	
Gas	1	
Water, plumbing and bathroom fittings	2	
Heating and hot water	2	
Drainage	1	

Category 3 Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1.	Which floor (s) is the living accommodation on?		Ground and	uppe	r
2.	Are there three steps or fewer to a main entrance to a property?	Yes	Х	No	
3.	Is there a lift to the main entrance door of the property?	Yes		No	Х
4.	Are all door openings greater than 750mm?	Yes		No	Х
5.	Is there a toilet on the same level as the living room and kitchen?	Yes	Х	No	
6.	Is there a toilet on the same level as a bedroom?	Yes	Х	No	
7.	Are all rooms on the same level with no internal steps or stairs?	Yes		No	X
8.	Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes	Х	No	

4. Valuation and conveyance issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

We are unaware of any adverse planning proposals affecting the subjects although this should be confirmed by obtaining a Property Enquiry Certificate.

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is recommended that where repairs, defects or maintenance items have been identified, particularly categorised as a 2 or 3, interested parties make appropriate enquiries in order to satisfy themselves of potential costs and the extent of the works required prior to submitting a legal offer to purchase.

The property has been altered/extended although historically. There is a rear single storey extension and an enlarged upper level dormer. It is assumed that all works were carried on to the appropriate regulation standards at the time.

Estimated reinstatement cost for insurance purposes

£300,000

It is assumed that insurance cover is obtainable on normal terms. The guidance figure is the estimate of costs for reinstating the subjects as at the date of inspection based on information provided by the Building Cost Information Service (BCIS). It is recommended that this figure is kept under regular review to ensure that you have adequate insurance cover. We are of the opinion that the subjects should be insured for buildings reinstatement purposes for a sum of not less than £300,000 (Three Hundred Thousand Pounds Sterling).

Valuation and market comments

£205,000

We are of the opinion that the market value of the subjects all as previously described and on a vacant possession basis would be fairly stated in the region of £205,000 (Two Hundred and Five Thousand Pounds Sterling).

Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.

Report author	Graeme Gilchrist, MRICS
Address	Seabraes House, 18 Greenmarket, Dundee. DD1 4QB.
Address	Seablaes House, 18 Greenmarket, Dundee, DD1 4QB.

Signed	i 1 0 0
	ALLAS
	Graeme Gilchrist MRICS For and on behalf of Graham + Sibbald LLP

Date of report	9/9/2024
----------------	----------

TERMS AND CONDITIONS OF SINGLE SURVEY

GENERAL

1.1 The Surveyors

The Seller has engaged the Surveyors to provide the Report and a Generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited energy company.

The Surveyors are authorised to provide a transcript or retype of the Generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by brokers and lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the Generic Mortgage Valuation Report and the Report. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the Generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and Generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors are required to amend the valuation in consequence of such information, they will issue an amended Report and Generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and Generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon residential property. *

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's agent or relative to the Property, they will be obliged to indicate this in the adjacent box. Yes

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

* Which shall be in accordance with the current RICS Appraisal and Valuation Standards (The Red Book) and RICS Rules of Conduct.

1.2 The Report

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to the 1st of December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Report is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Report may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective Purchasers and the Purchaser and their respective professional advisors without the prior written consent of the Surveyors.

1.3 Liability

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and is prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would be (or, as the case might be, would have been) disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisors of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

Graham + Sibbald's total liability to the Client (and any third party relying upon this report) under this Agreement (including liability in contract, tort (including negligence), breach of statutory duty, or otherwise) shall be limited to the lower of the following : a) 25% of the valuation or b) £250,000.

1.4 Generic Mortgage Valuation Report

The Surveyors undertake to the Seller that they will prepare a Generic Mortgage Valuation Report, which will be issued along with the Report. It is the responsibility of the Seller to ensure that the Generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 Transcript Mortgage Valuation for Lending Purposes

The Surveyors undertake that on being asked to do so by a prospective Purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. ** The Transcript Mortgage Valuation Report for Lending Purposes will be prepared from information contained in the Report and the Generic Mortgage Valuation Report.

** Which shall be in accordance with the current RICS Appraisal and Valuation Standards (The Red Book) and RICS Rules of Conduct.

1.6 Intellectual Property

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 Payment

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports, including replacement home reports.

1.8 Cancellation

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the Property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the Property, the Surveyor concludes that the Property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the following paragraph of this section.

In the case of cancellation by the Seller, for whatsoever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

If our account details change, we will notify these to you by letter or face to face and never by email.

1.9 Precedence

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 Definitions

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a Surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is the estimated amount for which the Property should exchange, on the date of valuation, between a willing seller and a willing buyer in an arms length transaction after proper marketing where the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in Part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property;
- the "Surveyors" are Graham + Slbbald LLP, a limited liability partnership incorporated in Scotland (Registered Number SO307130) and having its registered office address at Seabraes House, 18 Greenmarket, Dundee, DD1 4QB, of which the Surveyor is an employee, director or member (unless the Surveyor is not an employee, director or member, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report; and

30 Ceres Crescent Broughty Ferry Dundee DD5 3JN Dundee DUN-2024\09\0029 Inspection Date:- 05/09/2024 First Inspection Date (if applicable):-

- the "Energy Report" is the advice given by the accredited energy company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.
- "Data Protection Legislation" means the UK Data Protection Legislation and any other European Union legislation relating to personal data and all other legislation and regulatory requirements in force from time to time which apply to a party relating to the use of personal data (including, without limitation, the privacy of electronic communications).
- "UK Data Protection Legislation" means all applicable data protection and privacy legislation in force from time to time in the UK including the UK GDPR; the Data Protection Act 2018; the Privacy and Electronic Communications Directive 2002/58/EC (as updated by Directive 2009/136/EC) and the Privacy and Electronic Communications Regulations 2003 (SI 2003/2426) as amended.
- "UK GDPR" has the meaning given to it in section 3(10) (as supplemented by section 205(4)) of the Data Protection Act 2018.

DESCRIPTION OF THE REPORT

2.1 The Service

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by statute and this is in the format of the accredited energy company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 The Inspection

The inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the Property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the Property.

The inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the Report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Report of Property that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a register of asbestos and effective management plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 The Report

The Report will be prepared by the Surveyor who carried out the Property inspection and will describe various aspects of the Property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the Property will be concise and will be restricted to matters that could have a materialaffect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the Property is free of any other minor defects.

Throughout the Report the following repair categories will be used to give an overall opinion of the state of repair and condition of the Property:

2.3.1 Category 3:

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the Property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2:

Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1:

No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the Property. This is particularly true during slow market conditions when the effect can be considerable. Parts of the Property which cannot be seen or accessed will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 Services

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 Accessibility

A section is included to help identify the basic information interested parties need to know to decide whether to view a Property.

2.6 Energy Report

A section is included that makes provision for an Energy Report, relative to the Property. The Surveyor will collect physical data from the Property and provide such data in a format required by an accredited Eeergy company. The Surveyor cannot of course accept liability for any advice given by the energy company.

2.7 Valuation & Conveyancer Issues

The last section of the Report contains matters considered relevant to the conveyancer (solicitor). It also contains the Surveyors opinion both of the market value of the Property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation within a willing buyer and willing seller in an arms-length transaction after proper marketing wherein the parties have each acted knowledgably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of uninspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions.
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees). Sellers or prospective Purchasers may consider it prudent to instruct a re-inspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

It is assumed that any relevant Local Authority consents, warrants and completion certificates have been obtained where construction or alteration works have been undertaken.

This agreement and any dispute or claim arising out of or in connection with its subject matter shall be governed by and construed in accordance with the laws of Scotland, and the Scottish Courts will have exclusive jurisdiction to hear such claims.

DATA PROTECTION

Graham + Sibbald and the Client each undertake that:

- (a) they shall comply with all applicable requirements of the Data Protection Legislation, including without limitation any obligations relating to the rights of a data subject and the reporting of personal data breaches (all as defined in the UK GDPR); and
- (b) not do or omit to do anything which puts any other party to the Agreement in breach of the Data Protection Legislation.

Without prejudice to the generality of this clause, you shall ensure that you have all necessary appropriate consents and notices in place to enable lawful transfer of the personal data to Graham + Sibbald for the duration and purposes of this Agreement. You shall have liability for and shall indemnify Graham + Sibbald for any loss, liability, costs (including legal costs), damages, or expenses resulting from any breach by you of the Data Protection Legislation. For further information regarding how Graham + Sibbald processes personal data in relation to this Agreement, please see Graham + Sibbald's privacy notice on their website.

	Mortgage V	aluation Report fo	or Home Report	
Source: G+S Home Repo	ort Sel	ler Name Kevin an	d Sheelagh Stokoe	Reference DUN-2024\09\0029
1) Property Details	House Name			
	Number / Ext 30			
			-	
	1	eres Crescent	_	
	1	roughty Ferry	Destanda	
	Town D	undee	Postcode DD5 3JN	
2) Description of prope	-			
Property Type	House	House Type Semi-I	Detached Floor	number of subject property
Year Built 1960s		Non Traditional Cons	truction?	No. of floors in block
		(*Specify under gene	ral comments)	No. of flats in block
3) Accommodation - giv	a number of:			
· · ·	edrooms 2	Kitchens 1 E	Bathrooms 2 Total Insi	de W.C.s 2 No of floors 2
Other	Garage(s)	Single OI	utbuildings	Garden Private
		Single		
4) Tenure Absolute Ov	vnership	If Leasehold, yea	rs unexpired:	
1			d rent or service charges?	
		0	0	
Owner occupied	Tenanted x	Vacant		
If part tenanted, plea				
give deta				
5) Subsidence, Settlem	ent and Landslip			
		property located near		
	eave, settlement,sub	osidence,flooding or mi	ning?	
If yes, please clarify				
ciarity				
6) Condition of Propert		al repairs required?		Yes No x
		al repairs required?		Yes No x
Should the repairs b				Yes No
		tion recommended?		Yes No x
If the answer to any of	the above question	s is Yes, please provide	e further detail:	
				RICS
		Ра	ge 1 of 3	Regulated by RICS Chartered Surveyors
				A Quality Assured Firm

I

7) Services Mains water x Mains drainage x Electricity x Gas x Central heating	Gas
8) Insurance Reinstatement Value Total area of all floors measured internally (m²)	97m ² approx.
Cost of rebuilding inc. demolition, site clearance, professional fees, local authority requirements	
and main building (inc all other structures within the site boundaries unless specifically excluded	£300,000
9) Market Valuation for Mortgage Purposes (Assuming Vacant Possession) Comment on mortgageability	
In our opinion the property forms suitable security for loan purposes subject to specific lender`s c	riteria which may vary.
Valuation in present condition:	£205,000
Valuation on completion of any works required under Question 6:	
10) General Comments Please advise of any special features of the property and/or the location, which affects the proper	ty.
The subjects comprise a semi-detached single storey plus attic level dwelling erected by Messrs B â€~Almond` design. The subjects form part of a long established private residential location withi Surrounding properties are of a similar nature and all amenities can be found within easy reach. T overall condition having regard to its age and construction type. A degree of maintenance/upgradi far as possible we have reflected the condition of the subjects in our valuation.	n Broughty Ferry. Fhe subjects are in fair
The property has been altered/extended although historically. There is a rear single storey extension level dormer. It is assumed that all works were carried out to the appropriate regulation standards	
IMPORTANT - THIS IS A CONFIDENTIAL REPORT PREPARED FOR MORTGAGE PURPOSES. Certificate: I have personally inspected the property described herein and confirm adequate profese held.	ssional indemnity cover is
Company / Firm Name Gra	ham + Sibbald LLP
Office Name Du	
Signature Office Addr1 Sec	abraes House
Office Addr2 18	Greenmarket
Valuer name and Graeme Gilchrist MRICS Area gualification For and on behalf of Graham + Sibbald LLP	
Date of inspection 05/09/2024	
Date of report 09/09/2024	
Tel no 013	382 200064
Page 2 of 3	

MORTGAGE VALUATION - CONDITIONS OF ENGAGEMENT



In these Terms and Conditions of Engagement, the following expressions shall have the following meanings:

"Agreement" means these Terms and Conditions of Engagement, the Instructions and the confirmation letter issued by Graham + Sibbald.

"Client"/"you"/"your" means the person, firm, company, organisation or other entity engaging Graham + Sibbald to provide the inspection services.

"Data Protection Legislation" means the UK Data Protection Legislation and any other European Union legislation relating to personal data and all other legislation and regulatory requirements in force from time to time which apply to a party relating to the use of personal data (including, without limitation, the privacy of electronic communications).

"Graham + Sibbald"/"we"/"us"/"our" means Graham + Sibbald LLP, a limited liability partnership incorporated in Scotland (Registered Number SO307130) and having its registered office address at Seabraes House, 18 Greenmarket, Dundee, DD1 4QB.

"Instructions" means the written or verbal instructions by the Client to Graham + Sibbald, which appoint Graham + Sibbald to provide the inspection services.

"Property" means the property identified and described in the Instructions.

"UK Data Protection Legislation" means all applicable data protection and privacy legislation in force from time to time in the UK including the UK GDPR; the Data Protection Act 2018; the Privacy and Electronic Communications Directive 2002/58/EC (as updated by Directive 2009/136/EC) and the Privacy and Electronic Communications Regulations 2003 (SI 2003/2426) as amended.

"UK GDPR" has the meaning given to it in section 3(10) (as supplemented by section 205(4)) of the Data Protection Act 2018.

A valuation for mortgage is a limited inspection and report produced for building societies, banks and other lenders to enable them to make a lending decision. IT IS NOT A SURVEY. Unless otherwise stated the date of valuation will be the date of inspection.

This report is used to guide the lender on the market value of the Property for mortgage purposes and is carried out for this purpose alone. Although the inspection will be carried out by a valuer who will usually be a qualified surveyor it is not a detailed inspection of the Property, and only major visible defects will be noted. Subject to reasonable accessibility, the roof space is inspected only to the extent visible from the access hatch without entering it. The surveyor will not inspect under floor areas, communal roof space or other parts not readily accessible. The exterior and roof of the Property will be inspected from ground level only from within the boundaries of the site and adjacent/communal public areas. The area of the Property will be taken into account, and the rooms individually inspected, but floor coverings and furniture will not advise as to whether these comply with regulations in respect of these services.

The surveyor may recommend that a part of the mortgage be retained by the lenders until such time as particular repair works are carried out. Similarly, the report may suggest that the borrower should undertake to carry out certain repairs or commission more extensive investigation where hidden defects are suspected since these may have a material effect on the value of the Property. If a retention is recommended then the figure should not be regarded as an estimate of repair costs. Its purpose is to protect the interests of the lending institution. It is recommended that detailed estimates be obtained before proceeding with the purchase. Attention is drawn to the fact that if a subsequent transcription of this report is prepared on a lenders form, then in order to comply with the lenders specific requirements, the wording or phraseology may differ. Many people rely on the mortgage valuation certificate in the mistaken belief that it is a detailed survey. The report is often made available to house buyers by lenders, but this does not mean that it should be relied upon as a report on the condition of the building.

The definition of 'market value' is the estimated amount for which a Property should exchange on the date of valuation, between a willing buyer and a willing seller in an arms-length transaction after proper marketing wherein the parties had acted knowledgeably, prudently and without compulsion. For the purpose of this market value the surveyor has assumed that vacant possession will be provided. Unless otherwise stated the surveyor has valued the interest on a comparable basis.

The inspection that has been undertaken should not be regarded as a survey. The surveyor did not inspect parts of the Property which were covered, unexposed or inaccessible and are therefore unable to report that any such part of the Property is free from defect. Defects which are not considered materially to affect the value of the Property or other matters which would be attended to during maintenance, may not have been mentioned. If defects have been mentioned in this report, they should be regarded as indicative and not exhaustive. For the purposes of this valuation the surveyor assumes that all uninspected areas are free from defect which would have a material effect on value.

In accordance with our normal practice, we must state that this report is for the use only of the party to whom it is addressed or their named client and no responsibility is accepted to any third party for the whole or any part of its content.

In addition, we would bring to your attention that neither the whole nor any part of this report, nor any reference thereto, may be included in any document, circular or statement without prior written approval of the form and context in which it will appear.

The surveyor shall, unless otherwise expressly agreed, rely upon information provided by the Client and/or the Client's legal or other professional advisers relating to tenure, leases and all other relevant matters.

For the purposes of this valuation the surveyor has assumed that all ground burdens are nominal or have been redeemed and that there are no unusual outgoings or onerous restrictions contained within the titles of which we have no knowledge. The surveyor has further assumed that the subjects are unaffected by any adverse planning proposals.

Unless otherwise stated, it is assumed that all the required valid planning permissions and statutory approvals for the building and for their use, including any recent or significant extensions or alterations, have been obtained and complied with. It has been further assumed that no deleterious or hazardous materials or techniques have been used in the construction of the subject and that there is no contamination in or from the ground or from the immediate surrounds.

The surveyor will not carry out an asbestos inspection and will not be acting as an asbestos inspector in completing a valuation inspection of Property that may fall within the Control of Asbestos Regulations 2012. No enquiry of the duty holder, as defined in the Control of Asbestos Regulations 2012, of the existence of an asbestos register, or of any plan for the management of asbestos will be made. Your legal adviser/conveyancer should confirm the duty holder under these regulations, the availability of an asbestos register and the existence and management of any asbestos containing materials. For the purposes of this valuation, the surveyor has assumed that there is a duty holder, as defined in the Control of Asbestos Regulations 2006, and that a register of asbestos and effective management plan is in place which does not require any immediate expenditure or pose a significant risk to health or breach the HSE Regulations.

The surveyor confirms that this mortgage valuation is prepared in accordance with the RICS Valuation - Global Standards 2017 and incorporating IVSC International Valuation Standards and, unless other stated, we are External Valuares a defined therein. Further information may also be obtained from the Royal Institution of Chartered Surveyors in Scotland, 10 Charlotte Square, Edinburgh EH2 40R.

As part of this remit, the surveyor may, where he/she feels qualified and experienced to do so, provide general comment on standard appropriate supplementary documentation, presented to us by the Client's lender and conveyancer. In the event of a significant amount of documentation being provided to us, an additional fee may be incurred. Any additional fees will be agreed with you in advance.

We confirm that Graham + Sibbald operates formal procedures to deal with complaints from clients in accordance with By-law 19, Regulation 2.7 of the Royal Institution of Chartered Surveyors Rules of Conduct and Disciplinary Procedures. A copy of this procedure is available on request.

Graham + Sibbald's total liability to the Client (and any third party relying upon this report) under this Agreement (including liability in contract, tort (including negligence), breach of statutory duty, or otherwise) shall be limited to the lower of the following: a) 25% of the valuation or b) £250,000.

This agreement and any dispute or claim arising out of or in connection with its subject matter shall be governed by and construed in accordance with the laws of Scotland, and the Scottish courts will have exclusive jurisdiction to hear such claims.

Graham + Sibbald and the Client each undertake that: (a) they shall comply with all applicable requirements of the Data Protection Legislation, including without limitation any obligations relating to the rights of a data subject and the reporting of personal data breaches (all as defined in the UK GDPR); and (b) not do or omit to do anything which puts any other party to the Agreement in breach of the Data Protection Legislation.

Without prejudice to the generality of this clause, you shall ensure that you have all necessary appropriate consents and notices in place to enable lawful transfer of the personal data to Graham + Sibbald for the duration and purposes of this Agreement. You shall have liability for and shall indemnify Graham + Sibbald for any loss, liability, costs (including legal costs), damages, or expenses resulting from any breach by you of the Data Protection Legislation. For further information regarding how Graham + Sibbald's privacy notice available via our website.

Energy Performance Certificate (EPC)

Scotland

Dwellings

(92 plus)

(81-91)

(69-80)

(55-68)

(39-54

(21-38)

(1-20)

B

Not environmentally friendly - higher CO₂ emissions

D

F

G

30 CERES CRESCENT, BROUGHTY FERRY, DUNDEE, DD5 3JN

Dwelling type:	Semi-detached house
Date of assessment:	05 September 2024
Date of certificate:	09 September 2024
Total floor area:	97 m ²
Primary Energy Indicator:	308 kWh/m ² /year


Reference number: Type of assessment: Approved Organisation: Main heating and fuel: 3514-5021-1000-0875-7202 RdSAP, existing dwelling Elmhurst Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£5,964	See your recommendations
Over 3 years you could save*	£1,971	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

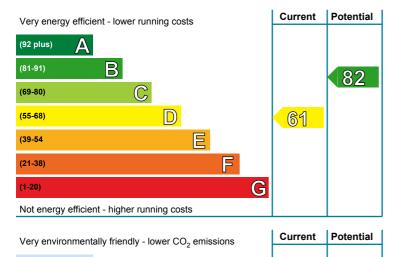

Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (61)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band E (54)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

79

54

Recommended measures	Indicative cost	Typical savings over 3 years
1 Room-in-roof insulation	£1,500 - £2,700	£801.00
2 Cavity wall insulation	£500 - £1,500	£189.00
3 Floor insulation (suspended floor)	£800 - £1,200	£462.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282. THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

30 CERES CRESCENT, BROUGHTY FERRY, DUNDEE, DD5 3JN 09 September 2024 RRN: 3514-5021-1000-0875-7202

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, filled cavity Cavity wall, as built, partial insulation (assumed)	★★★☆☆ ★★★☆☆	★★★☆☆ ★★★☆☆
Roof	Flat, limited insulation (assumed) Roof room(s), ceiling insulated	★★☆☆☆ ★★☆☆☆	★★☆☆☆ ★★☆☆☆
Floor	Suspended, no insulation (assumed)	—	
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and bypass	★★★☆☆	★★★☆☆
Secondary heating	None	—	_
Hot water	From main system	★★★ ☆	★★★★☆
Lighting	Low energy lighting in 50% of fixed outlets	★★★★☆	★★★★☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 54 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.3 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 2.8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home				
	Current energy costs	Potential energy costs	Potential future savings	
Heating	£4,878 over 3 years	£3,255 over 3 years		
Hot water	£573 over 3 years	£396 over 3 years	You could	
Lighting	£513 over 3 years	£342 over 3 years	save £1,971	
Totals	£5,964	£3,993	over 3 years	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

De		Indicative cost	Typical saving	Rating after improvement	
Re	commended measures	indicative cost	per year	Energy	Environment
1	Room-in-roof insulation	£1,500 - £2,700	£267	D 66	D 61
2	Cavity wall insulation	£500 - £1,500	£63	D 67	D 62
3	Floor insulation (suspended floor)	£800 - £1,200	£154	C 70	D 66
4	Low energy lighting for all fixed outlets	£30	£49	C 71	D 67
5	Upgrade heating controls	£350 - £450	£65	C 72	D 68
6	Solar water heating	£4,000 - £6,000	£60	C 73	C 70
7	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£489	B 82	C 79

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

• External insulation with cavity wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Room-in-roof insulation

Insulating roof rooms will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. If it has a flat ceiling insulation can usually be added above the ceiling, and sloping ceilings and walls of roof rooms can be insulated using an internal lining board. Roof voids must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about roof room insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

3 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

4 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

5 Heating controls (room thermostat)

The heating system should have a room thermostat to enable the boiler to switch off when no heat is required. A competent heating engineer should be asked to do this work. Insist that the thermostat switches off the boiler as well as the pump and that the thermostatic radiator valve is removed from any radiator in the same room as the thermostat. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

6 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

7 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	16,815	(631)	(688)	N/A
Water heating (kWh per year)	2,231			

Addendum

30 CERES CRESCENT, BROUGHTY FERRY, DUNDEE, DD5 3JN 09 September 2024 RRN: 3514-5021-1000-0875-7202

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Assessor membership number:	Mr. Graeme Gilchrist EES/022325
Company name/trading name:	Graham & Sibbald
Address:	Seabraes House 18 Greenmarket
	Dundee
	DD1 4QB
Phone number:	01382 200064
Email address:	dundee@g-s.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.





Property address	30 Ceres Crescent
	Broughty Ferry
	Dundee

Seller(s)	Kevin and Sheelagh Stokoe
-----------	---------------------------

Completion date of property questionnaire	05/09/2024
---	------------

GRAHAM - SIBBALD

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership	
	How long have you owned the property? 12 years	
2.	Council tax	
	Which Council Tax band is your property in? B	
3.	Parking	
	What are the arrangements for parking at your property? (Please tick all that apply) • Garage Yes • Allocated parking space • Driveway Yes • Shared parking • On street • Resident permit • Metered parking • Other (please specify):	
4.	Conservation area	
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	No
6.	Alterations/additions/extensions	
a.	 (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? <u>If you have answered yes</u>, please describe below the changes which you have made: 	Νο
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for	
	checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three	No
	questions below:(i) Were the replacements the same shape and type as the ones you replaced?	
	(ii) Did this work involve any changes to the window or door openings?	
	(iii) Please describe the changes made to the windows dates when the work was completed):	doors, or patio doors (with approximate
	Please give any guarantees which you received for this	work to your solicitor or estate agent.

7.	Central heating	
a.	Is there a central heating system in your property?	
	(Note: a partial central heating system is one which does not heat all the main rooms of the property –	Yes
	the main living room, the bedroom(s), the hall and the bathroom).	
	If you have answered yes or partial - what kind of central heating is there?	
	(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	Gas	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial cen	tral heating system installed?
	Nk	
	(ii) Do you have a maintenance contract for the central heating system?	Yes
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
	WRB gas	
	(iii) When was your maintenance agreement last renewed year).	d? (Please provide the month and
	July 24	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	No
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	
b.	Are you aware of the existence of asbestos in your property?	Νο
	If you have answered yes, please give details:	

10.

Services

a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas or liquid petroleum gas	Yes	
Water mains or private water supply	Yes	
Electricity	Yes	
Mains drainage	Yes	
Telephone	Yes	
Cable TV or satellite	Yes	
Broadband	Yes	

b.	Is there a septic tank system at your property? If you have answered yes, please answer the two questions below:	Νο
	(iv) Do you have appropriate consents for the discharge from your septic tank?	
	 (v) Do you have a maintenance contract for your septic tank? <u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract: 	

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	No
	If you have answered yes, please give details:	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	No
	If you have answered yes, please give details:	
с.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	No
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?	Νο
	If you have answered yes, please give details:	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? <u>If you have answered yes</u> , please give details:	No
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	No
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	No
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	

[
b.	Is there a common buildings insurance policy?	No
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	
с.	Please give details of any other charges you have to of common areas or repair works, for example to a or stair fund.	
13.	Specialist works	
а.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Νο
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Νο
	If you have answered yes, please give details:	
с.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please write</u> <u>below who has these documents</u> and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees		
a.	Are there any guarantees or warranties for	or any of the following:	
(i)	Electrical work		No
(ii)	Roofing		No
(iii)	Central heating		No
(iv)	National House Building Council (NHBC)		No
(v)	Damp course		No
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)		No
b.	If you have answered 'yes' or 'with title d to which the guarantee(s) relate(s):	eeds', please give details	of the work or installations
с.	Are there any outstanding claims under a listed above?	iny of the guarantees	No
	If you have answered yes, please give de	tails:	
15.	Boundaries		
	So far as you are aware, has any bounda moved in the last 10 years?	ry of your property been	No
	If you have answered yes, please give de	etails:	

16.	Notices that affect your property	
	In the past three years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Νο
b.	that affects your property in some other way?	No
с.	that requires you to do any maintenance, repairs or improvements to your property?	No
	If you have answered yes to any of a-c above, please g estate agent, including any notices which arrive at any purchaser of your property.	5

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

і ассерт 🗹

Name: Sheelagh Stokoe

Date: 05/09/2024